REVISED PRELIMINARY GEOTECHNICAL EXPLORATION REPORT PROPOSED EAST KAPOLEI PHASE II DEVELOPMENT STUDY AREA I HONOULIULI, EWA, OAHU, HAWAII

For

Community Planning and Engineering, Inc. 1100 Alakea Street, 6th Floor Honolulu, Hawaii 96813

By:



Geotechnical • Environmental • Construction Management Testing • Inspection • Drilling & Sampling

> CORPORATE HEADQUARTERS 94-547 Ukee Street, Suite No. 210 Waipahu, Hawaii 96797

Tel: (808) 676-6677 - Fax: (808) 676-7733 - Email: pscwahi@pscconsultants.com

TABLE OF CONTENTS

	Page
SUMMARY OF FINDINGS AND RECOMMENDATIONS	1
INTRODUCTION	2
PROJECT CONSIDERATIONS	2
PURPOSE AND SCOPE	3
REGIONAL GEOLOGY	3
Geology of Study Area and Vicinity	4
EXISTING SITE CONDITIONS	4
SUBSURFACE EXPLORATION	4
SUBSURFACE CONDITIONS	5
DISCUSSIONS AND RECOMMENDATIONS	
Site Preparation	5
Fill Material and Placement	6
Fill Material	6
Open Space, Park, and Non-Structural Areas	
Placement	0
Select Borrow Fill Thickness	7
Slopes	/
Slope Construction	······································
Slope Erosion Protection	·····/
Foundations	
Excavation	o
Slabs-On-Grade	0
Site Drainage	o
Pavements	۶ ۱۸
Sidewalks	۱۵
Utility Trenches	10
Retaining Walls	10 11
Active Pressure	
Passive Pressure	
Coefficient of Friction	
Allowable Bearing Pressure	11
Backfill Requirements	
Requirements for Imported Fill Under Foundations	
Design Review	1∠ 12
Construction Observation and Testing	12
	17

REVISED PRELIMINARY GEOTECHNICAL EXPLORATION REPORT PROPOSED EAST KAPOLEI PHASE II DEVELOPMENT STUDY AREA I HONOULIULI, EWA, OAHU, HAWAII

June 30, 2009

PSC Job No. 27303.10

SUMMARY OF FINDINGS AND RECOMMENDATIONS

The field exploration encountered about 6 to 12 inches of topsoil consisting of clayey silt and silty clays. Gravel and asphalt topsoil were also encountered in southwestern boundary of the site. The field exploration generally encountered very stiff to hard and very hard silty clay alluvial soils. A very dense coral formation was encountered in Boring Nos. B-1, B-3, and B-13 near the southern boundary of the property at depths of 13.5, 14, and 14.5 feet below ground surface, respectively. The coral formation was not encountered in the remaining borings within Study Area I. Groundwater was not encountered in any of the borings drilled.

Based on the field exploration and observations, the stiff to hard, near-surface materials encountered at the site should provide adequate support for the proposed residential housing development. However, laboratory tests show that the near-surface, silty clay soils exhibit moderate shrink and swell potential when subjected to changes in moisture content. Special attention should therefore be given to the preparation of subgrade and design of slab-on-grade and pavements for this project. To limit the development of cracks on floor slabs, walls, and pavements as a result of the anticipated movement of the subgrade soils, the following alternatives or a combination thereof may be adopted:

- 1. Control and maintenance of the near-surface subgrade soil moisture conditions during and after construction.
- 2. Design structures to withstand anticipated incremental movements of the subgrade soils i.e. with post tensioning techniques or design the structures to allow a limited flexibility of movement and,
- 3. Over excavate and replace the near-surface soils with non-expansive select borrow;

The above construction methods, special design recommendations, and grading schemes are discussed in more detail in the text of this report.



INTRODUCTION

East Kapolei II Development is divided into 2 study areas namely; Study Area I and Study Area II, as shown in the Project Location Map, Plate No. 1. This report is for Study Area I, and is the first of 2 preliminary geotechnical exploration reports for the East Kapolei II Development. Study Area I consists of the following parcels:

- 12-acre KROC Center;
- 4.7, 8.1, and 4.1-Acre Parks;
- 20.4 and a 19.7 acre Low Density Apartment (LDA) Lots;
- 153-lot subdivision parcel (Increment II-B);
- 220-lot subdivision parcel (Increment II-A);
- 105 ft-wide access road (East-West Road); and
- Subdivision road network.

A 17-acre parcel for a middle school is within Study Area I, but is not included in our investigation. A separate study will be done for this parcel by the Department of Education (DOE) in the future.

Our work was performed in general accordance with our February 12, 2007 proposal to Community Planning and Engineering, Inc. (CP&E). This report summarizes our findings and recommendations.

PROJECT CONSIDERATIONS

The proposed East Kapolei Phase II Development Study Area I consists of individual residential lots, paved roads, 3 community parks, a 12-acre KROC Center, a 26.6 acre Ilima conservation park, a sewer line corridor running along Mango Tree Road and 2 low-density apartment (LDA) complexes (Plate No. 2).

For Study Area I, 22 borings were drilled and 5 test pits were hand excavated by PSC Consultants, LLC (PSC) to examine the near surface silty clay overburden soils and to obtain samples for CBR and index property tests.

We anticipate the future residence/structures to be 1- to 2-story homes, supported by slab-on-grade with thickened edges and/or shallow-spread or continuous footings to be built by the developer or individual homeowners.



PURPOSE AND SCOPE

The purpose of our preliminary geotechnical exploration was to gather information on the nature, distribution, and characteristics of the subsurface soils encountered within Study Area I and to provide recommendations for the development of the proposed residential subdivisions within this area. The scope of our exploration consisted of the following tasks and work efforts:

- 1. Scheduling and planning the investigation;
- 2. Project coordination and site preparation;
- 3. Drilling 22 borings to 15 feet below the existing ground surface and excavating 5 hand-dug test pits and collecting bulk samples for classification and laboratory testing;
- 4. Providing a field engineer to monitor the drilling operations, obtain soil samples at selected depths, and maintain field logs of the soils encountered;
- 5. Performing laboratory tests on selected soil samples obtained from the borings and test pits to evaluate relevant engineering characteristics of the soils encountered;
- 6. Analyzing the field and laboratory data;
- 7. Reviewing soil information and related data on the project site and immediate vicinity; and
- 8. Preparing and submitting a written preliminary geotechnical engineering exploration report summarizing our findings, conclusions and recommendations for grading, pavement design, foundations and other geotechnical aspects.

REGIONAL GEOLOGY

Two basaltic shield volcanoes, Waianae and Koolau, built up the island of Oahu. The Waianae area, which forms the west side of the island, is the older of the 2 areas and was built during the Pliocene Epoch by the extrusion of the lavas of the Waianae Volcanic Series. As volcanic activity in Waianae ceased, lava flows from Koolau banked against the Waianae eroded slope forming a broad Plateau presently known as Schofield Plateau. Physical and chemical weathering followed by erosion of this plateau generated sediments, which were transported to the coast. In the vicinity of the project site and to the south, these sediments accumulated and interbedded with marine sediments and coral algal reef formation to form a sedimentary wedge. The thickness of the sedimentary wedge ranges from zero in the area of the interstate route H-1 highway to over 1,000 feet in Ewa Beach. This wedge forms the Ewa plain and serves as the confining formation over the artesian basal aquifers of southern Oahu. Deposition of sediments has continued from earlier geologic time through the present. Agricultural developments within the last 100 years and recent mass grading work have brought this part of Ewa Plains in Honouliuli, East Kapolei to its present form.



Geology of Study Area and Vicinity

The soils within the study area and surrounding Honouliuli and Ewa plains, belong to the Honouliuli Series (HxA) based on the Soil Survey of Oahu by the US Department of Agriculture Soil Conservation Service, 1972. This series consists of well-drained soils in the Ewa area on the Island of Oahu (Plate No. 3). These soils developed in alluvium derived from basic igneous material. They are nearly level and gently sloping. Elevations range from 15 to 125 feet. The annual rainfall in this area is from 10 to 20 inches, occurring mainly between November and April. Honouliuli soils are geographically associated with Ewa, Lualualei, Mamala, and Waialua.

EXISTING SITE CONDITIONS

The project site is located to the east of the existing Villages of Kapolei Development in the district of Ewa, Oahu, Hawaii. The study area is bound by the North-South Road on the west and by Mango Tree Road on the south. The northern and eastern boundaries of the property lie adjacent to cultivated fields (diversified agriculture). The western portion of Study Area I, comprising about a third of the project area, is currently uncultivated and is overgrown with grass and scattered with occasional Koa and Keawe bushes. Evidence of previous cultivation of sugar cane can be traced from the still upright but decayed remains of the last crops and the almost uniform consistency of the near-surface soils from seasons of cultivation. This unused portion of the property is generally dry and shows extensive cracking of the near surface soils due to dry conditions. The shrinkage cracks are about 3 to 5 inches wide at the surface and extend down about 2.5 to 3.5 feet below the surface. The topsoil within the uncultivated parcel contains considerable amounts of organic materials from decayed plant matter. The rest of the project area is currently being cultivated and planted with corn and various vegetable crops. Study Area I is generally flat with slopes estimated at less than 1 percent. Elevations range from about 58 feet in the vicinity of Boring No. B-3 near the southern boundary to about 75 feet at Boring No. B-19 near the northern boundary of Study Area I.

SUBSURFACE EXPLORATION

The subsurface conditions in Study Area I were explored by drilling and sampling 22 borings (Boring Nos. B-1 through B-22) to a depth of 15 feet below the existing ground surface and hand excavating and sampling 5 test pits (Test Pit Nos. TP-1 through TP-5) to depths of about 3.5 feet below the existing ground surface. The approximate locations of the borings and test pits are shown in the Site Plan, Plate No. 2.



SUBSURFACE CONDITIONS

The field exploration encountered about 6 to 12 inches of topsoil consisting of clayey silt and silty clays that were observed to be generally dry and loose from cultivation. The topsoil within the uncultivated parcel on the western half of Study Area I contains considerable amounts of organic materials from decayed plant matter. Gravel and asphalt topsoil were also encountered in southwestern boundary of the site. The underlying soils were very stiff to hard and very hard silty clay alluvial soils. A very dense coral formation was encountered in Boring Nos. B-1, B-3, and B-13, near the southern boundary of the property at depths of 13.5, 14, and 14.5 feet below ground surface, respectively. The coral formation was not encountered in the rest of the 15-foot borings within Study Area I. Groundwater was not encountered in any of the borings drilled.

Detailed descriptions of the materials encountered are shown in the Logs of Borings and Logs of Test Pits, Plate Nos. 4 through 25 and 26 through 30, respectively.

DISCUSSIONS AND RECOMMENDATIONS

Our field exploration generally encountered alluvium materials consisting of very stiff to hard brown silty clays. A very dense coral formation was encountered in Boring Nos. B-1, B-3, and B-13, near the southern boundary of the property at depths of 13.5, 14, and 14.5 feet below ground surface, respectively. Stiff to very stiff brown silty clay was encountered in Test Pit Nos. TP-1 through TP-5 to 3.5 feet deep. Laboratory tests indicate that these silty clay alluvial soils have a low to moderate expansion potential (ranging about 3 to 8 percent) when subjected to increases in moisture content, as shown in the CBR expansion tests (Plate Nos. 38 through 42) and one-dimensional swell tests (Plate No. 43). Our site observations also indicate that these soils have the potential to shrink and swell, and develop relatively deep surface cracks when left unattended for extended periods of time.

Site Preparation

At the onset of earthwork, the area within the contract grading limits should be cleared of trees, vegetation, debris, rubbish, and other deleterious materials. These materials should be removed and properly disposed of off-site.

After the clearing and removal of unsuitable surface materials, the area should be proof-rolled to locate soft and yielding spots. Soft or yielding areas encountered should be over-excavated to expose firm soil surface and stabilized by backfilling with select material placed in 8-inch thick, loose lifts, moisture-conditioned to at least 2 to 3 percent above the optimum moisture content and compacted to 90 percent relative compaction. In areas to receive fill, the ground surface should be scarified to a depth of 6 inches, moisture-conditioned to at least 2 to 3 percent above the optimum moisture content, and compacted to a minimum of 90 percent relative compaction.



Relative compaction refers to the in-place dry density of soil expressed as percentage of the maximum dry density of the same soil established in accordance with ASTM Test designation D 1557-91. The optimum moisture content is the moisture content corresponding to the maximum compacted dry density.

Site preparation and grading operation should be observed by a representative of PSC. It is important that a representative from our office observe the site preparation and to perform field density tests to evaluate whether any undesirable materials are encountered during the excavation and scarification process and whether the exposed soil conditions are similar to those anticipated in our engineering analysis.

Fill Material and Placement

<u>Fill Material</u> - Proper site preparation and compaction of new fills and bonding of new fills to existing ground are required to provide a stable fill mass. Except for the parks, materials used for general subdivision site embankment filling should be non-expansive select material, generally less than 3 inches in maximum dimension; should have a plasticity index not exceeding 15, as determined in accordance with ASTM Test Method D 4318-84; and should have maximum 20 percent of particles passing the No. 200 sieve. Offsite borrow materials should be tested by PSC Consultants, LLC to evaluate its suitability for use as select fill prior to its delivery to the project site.

Open Space, Park, and Non-Structural Areas - If desired, the top soil from adjacent areas may be stockpiled and used as fill within parks and open spaces, provided no structures will be constructed over these fills. Future changes in land use in the park fill areas will need a detailed soil investigation, particularly when buildings are planned.

<u>Placement</u> - Fill materials in the subdivision area should be placed in level lifts with a maximum loose thickness of 8 inches, moisture conditioned to at least 2 percent above optimum, and compacted to a minimum of 90 percent relative compaction. In roadway areas, the minimum degree of compaction within the upper 2 feet of the subgrade should be 95 percent. Each layer should be spread uniformly and blade-mixed to attain uniformity of the material and water content. Additional fill material should not be placed on any fill layer that has not been properly compacted.

Select Borrow Fill Thickness

Select non-expansive borrow fill at housepads should be 2½-feet thick, placed over properly prepared subgrade as described in the Site Preparation portion of this report.

At driveway aprons and curb ramps, the select non-expansive borrow fill should be 2-feet thick over properly prepared subgrade and borrow extends 4-feet onto planter and sidewalk areas.



At sidewalks, the select non-expansive borrow should be 8-inches thick and transitions to 2-feet (on a grade of 3:1), where it joins with the extended select borrow at driveway aprons and curb ramps. It is imperative to maintain the subgrade 3% above optimum moisture during and after sidewalk construction to limit movement to tolerable limits.

Slopes

<u>Slope Construction</u> - In cases where sloping fills are required, such as at the edge of fill embankments, these may be designed at 2H:1V or flatter. Fill slopes should be constructed by overfilling 2 to 3 feet, then cutting back to the design slope to expose a well-compacted face.

Slope Erosion Protection - Water should be diverted away from the slopes by diversion ditches at the tops and surface drains on slope surface and sub drains may be used to provide adequate drainage. Slope planting should be utilized to reduce erosion potential.

Foundations

Information on the proposed residential structures was not available at the time this report was prepared. We anticipate that 1- to 2-story buildings with relatively light loadings will be constructed. Thickened-edge slab-on-grade foundations bearing on the properly compacted granular select materials may be used to support the proposed residential and other light structures.

An allowable bearing pressure of 2,500 psf for dead plus live loads may be used for footings bearing on the undisturbed very stiff to hard natural soils and on properly compacted non-expansive granular select borrow fills over properly prepared and compacted subgrade. The allowable bearing pressure may be increased by 1/3 for transient loadings, such as wind or seismic forces.

We estimate the maximum total footing settlements should not exceed 1 inch with maximum differential settlement of 1/2 inches for the above foundation schemes.

Where footings are located adjacent to or on slopes, the footings should be embedded deep enough to provide a minimum horizontal set-back distance of at least 6 feet measured from the outbound edge of the footing to the face of the slope. Where footings are to be located adjacent to below-grade structures or utilities, the footings should extend to a depth below an imaginary 45-degree plane, projected upward from the bottom of the below-grade structure or utility. This requirement is necessary to avoid surcharging adjacent below-grade structures with additional structural loads and to reduce the potential of foundation settlement.

Lateral loads acting on the structure may be resisted by frictional resistance between the base of the footings and the bearing materials and by passive earth pressure developed against the



footings. A coefficient of 0.25 may be used to compute the frictional resistance and the passive pressure may be calculated using an equivalent fluid pressure of 250 pounds per square foot per foot of depth (pcf). These values assume that the concrete for footings is poured directly against the footing excavations. Unless covered by pavements or slabs, the passive resistance in the upper 12 inches below finished grade should be neglected in the computation of the passive pressure.

Excavation

Natural soils may be excavated utilizing conventional equipment. The very stiff to hard subsurface silty clay or coral formation should be excavated using heavy-duty equipment. Contractors, especially those digging utilities, should satisfy themselves as to the hardness of deposits and select the most appropriate type of equipment required.

For temporary unsurcharged construction excavations, the excavations should be sloped or shored. Slopes should not be steeper than 1H:1V in granular soils, and 1/2H:1V in fine-grained soils. If there is insufficient space for sloped excavations, shoring should be used. Traffic and surcharge loads should be kept back at least 10 feet from the top of the excavations. Slopes should be inspected during construction/excavation to determine if they need to be flattened based on exposed conditions. Exposed slopes should be kept moist (but not saturated) during construction.

Slabs-On-Grade

We anticipate that concrete slab-on-grade floors will be used for the proposed residential buildings. We recommend that a 4-inch cushion layer of No. 3B fine gravel (ASTM C 33, No. 67 gradation) be used below the slabs. To reduce future moisture infiltration and subsequent damage to floor coverings, vapor membrane should be incorporated on top of the 3B fine gravel cushion layer to reduce potential damage to moisture sensitive floor coverings by infiltration of moisture. To provide protection to the moisture barrier, a 2-inch layer of moist sand is recommended on top of the moisture barrier/geomembrane. This layer of sand will protect the geomembrane and also aid in the curing of the concrete slab.

Site Drainage

Subdrains should be provided where there is a possibility that runoff or irrigation could saturate the subsurface soils.

Exposed surface soils should be protected from erosive runoff by providing surface drains, diversion berms, and other flood control devices. The finished lot grade should be shaped to shed water away from foundations and to avoid ponding conditions. In addition, it is advised that each residence and building be equipped with a gutter and downspout system and the water



diverted as far away as possible from the house foundations and driveway. Collected water should be drained into an approved drainage system, and not allowed to flow freely on the site. Excessive landscape watering near foundations should be avoided.

Pavements

The pavement sections are based on medium subdivision traffic. In areas with heavier traffic, such as main collector roads, the section should be thickened with an additional 1/2-inch asphaltic concrete to provide adequate support for the increased traffic loading.

The minimum pavement section is as follows:

For the subdivision roads with 48- to 66-feet rights of way (ROW):

2-Inches	Asphalt Concrete
6-Inches	Asphalt Treated Base
12-Inches	Subbase
20-Inches	Total Pavement Thickness

For collector road with 78-feet ROW:

2½-Inches	Asphalt Concrete	
6-Inches	Asphalt Treated Base	
12-Inches	Subbase	
20½-Inches	Total Pavement Thickness	

The subbase will consist of a minimum 12 inches of compacted select borrow granular fill materials or aggregate subbase with a minimum CBR value of 25 and compacted to 95% relative compaction.

Coral or non-expansive select granular borrow material consisting of crusher run waste, mudrock, sand, or cinders may be used as subbase for the road pavement as described in the Standard Specifications for Public Works Construction (1986).

CBR and density test and/or field observations should be performed on the actual subgrade used for the roadway subgrade construction to confirm the adequacy of the above pavement sections. The recommended section assumes that adequate drainage will be provided in the paved areas.

Paved areas should be sloped and drainage gradients maintained to carry all surface water off the site. Surface water ponding should not be allowed anywhere on the site during or after construction.



Sidewalks

It is anticipated that concrete sidewalks along the subdivision roads will be constructed as part of the road network development. The subbase for the sidewalk should consist of a minimum of 8 inches of select granular borrow fill. The subbase should be graded to the required cross-section, moisture-conditioned to above optimum moisture content and compacted to at least 95-percent relative compaction.

Utility Trenches

We envision that utility lines will be required for the proposed subdivision project. Granular bedding consisting of 6 inches of No. 3B Fine gravel is recommended under the pipes. Free draining granular materials, such as No. 3B Fine gravel (ASTM C 33, No. 67 gradation), should also be used for the trench backfill, up to about 12 inches above the pipes to provide adequate support around the pipes and to reduce compaction requirement of the backfill, and thus reducing the potential for damaging the pipes.

The upper portion of the trench backfill from 1-foot above the pipes to the top of the subgrade or finished grade should consist of select granular material. The backfill should be moisture conditioned, placed in maximum 8-inch, level, loose lifts, and mechanically compacted to not less than 90 percent relative compaction to reduce the potential for future ground subsidence. Where trenches are below pavement areas, the upper 2 feet of the trench backfill above the pavement subgrade should be compacted to 95 percent relative compaction.

Where the sewer line trench bottom is on expansive clay soils, the trench should be over-excavated below invert elevation by at least 18 inches and replaced with No. 3B Fine gravel wrapped with geofabric comparable to Mirafi 140N or equivalent. The aggregate fill shall be placed in 6-inch layers, compacted and brought to within 6 inches of the invert grade as specified in Section 11.4-B of the Standard Specifications for Public Works Construction. Excavation and backfill for manholes shall likewise be in accordance with Section 11, Trench Excavation and Backfill of the Standard Specifications for Public Works Construction. These over-excavation with granular backfill are measures to limit the effects of possible differential settlements or heave in the utility pipes resulting from changes in moisture content of the surrounding clay soils.

Retaining Walls

We understand that walls may be constructed at the site for grade separation, and boundary delineation. Walls that are subjected to unbalanced lateral loading shall be designed as retaining walls. The retaining wall structures should be designed to resist the lateral earth pressures due to



adjacent soils and surcharge effects. Based on the current subsurface soil information, we recommend the following for the design of the retaining walls:

Active Pressure - An active pressure of 35 pcf in equivalent fluid weight is recommended.

Passive Pressure - A passive pressure of 250 pcf in equivalent fluid weight is recommended.

<u>Coefficient of Friction</u> - A coefficient of friction of 0.25 is recommended between the base of the footings and the supporting materials.

The above values assume that the concrete for footings is poured directly against the footing excavations. Unless covered by pavement or slabs, the passive resistance in the upper 12 inches below the finished grade should be neglected in the computation of the passive pressure.

Allowable Bearing Pressure - An allowable bearing pressure of up to 2,500 psf is recommended.

<u>Backfill Requirements</u> - Backfill behind the embedded walls should consist of imported select granular materials. Backfill behind the wall should be compacted to at least 90 percent maximum dry density as determined by ASTM D-1557, but not over compacted. Over compaction of the backfill material should be avoided so as not to create excessive lateral pressures against the wall.

Requirements for Imported Fill Under Foundations - Imported fill under foundations should be non-expansive, select material, generally less than 3 inches in maximum dimension; should have a plasticity index not exceeding 15, as determined in accordance with ASTM Test Method D 4318-84; and should have maximum 20 percent of particles passing the No. 200 sieve. The wall footing should be supported on at least 12 inches of select borrow or granular material compacted to 95 percent of maximum dry density.

The values provided above assume that imported granular fill will be used to backfill behind the wall. An active condition may be used for walls that are free to deflect by as much as 0.5 percent of the wall height. Generally, top of walls, which are not free to deflect beyond this degree or are restrained, should be designed for the at-rest condition. These lateral earth pressure values do not include hydrostatic pressure or surcharge loads that might be caused by groundwater trapped behind the walls.

For sloping backfill behind a wall up to 2H:1V, these values should be increased by a factor of 1.5. The surcharge effect from loads adjacent to retaining structures should also be included in the design of the walls. A rectangular distribution over the height of the wall with a pressure equal to 50 and 65 percent of the surcharge load is recommended for active and at rest conditions, respectively.



Retaining walls should be provided with backdrains or weep holes to prevent the buildup of hydrostatic pressures. If seepage through the wall is objectionable, back-drainage should be collected in a perforated pipe that discharges into gutters or suitable drainage. A typical drainage system would consist of a 1- to 2-foot wide zone of permeable material, such as No. 3B Fine gravel (ASTM C 33, No. 67 gradation), immediately adjacent to the wall with a perforated pipe, with perforations down at the base of the wall. The pipe should be sloped to drain into a suitable drainage system. A geotextile fabric, such as Mirafi 140N, or equivalent, should be placed between the gravel and the compacted backfill material. The drainage material should extend from the base to a height within 2 feet below finished grade. The remaining backfill should consist of an impervious capping of low expansive soil to reduce water infiltration behind the walls.

As an alternative, a prefabricated drainage board, such as MiraDrain, EnkaDrain, may be used in lieu of the permeable 3B Fine gravel material. The prefabricated drainage product should also be hydraulically connected to a perforated pipe, with perforations down, at the base of the wall. It is possible that wet spots in the wall may occur, with or without a perimeter drainage system. If this is objectionable, the exterior portions of the walls should be waterproofed.

Design Review

Drawings and specifications for the proposed construction should be submitted to PSC Consultants, LLC, as geotechnical consultant, for review and written comments prior to construction. This review is needed to evaluate adherence of the plans to the recommendations provided herein. If this review is not made, PSC cannot assume responsibility for the interpretations made by others, or errors resulting there from.

Construction Observation and Testing

The recommendations provided in this report are based on subsurface conditions disclosed by widely spaced exploratory borings and excavations. The geotechnical consultant should check the interpolated subsurface conditions during construction. The geotechnical consultant should attend the pre-construction meeting between the contractors and owners/designers.

During grading, the geotechnical consultant should:

- Observe excavation, placement, and compaction of engineered fill for new structures and pavements;
- Observe preparation and compaction of aggregate base for asphalt/concrete pavement and flatwork subgrade;
- Check and test any imported materials prior to their use as fill;



- Perform field tests to evaluate fill compaction;
- Observe subgrade conditions at the bottom of pipeline trenches;
- Observe fill placement and compaction around the pipes in the utility trenches; and
- Observe the fine-grading and exterior drainage improvements constructed around the finished structures.

The recommendations provided in this report assume that PSC will be retained as the geotechnical consultant during the construction phase of the project. If another geotechnical consultant is selected, we request that the selected consultant provide a letter to the architect/designer and owner/client (with a copy to PSC) indicating that they fully understand our recommendations and that they are in full agreement with the recommendations contained in this report. If deviations from soil conditions and recommendations presented in this report occur, they should provide amended recommendations as new geotechnical consultants of record for the project.

LIMITATIONS

The analyses and recommendations submitted in this report are based, in part, upon information obtained from field borings. Variations of subsoil conditions between the borings may occur, and the nature and extent of these variations may not become evident until construction is underway. If variations then appear evident, it will be necessary to reevaluate the recommendations provided in this report.

The test pits and boring locations in this report were selected by PSC Consultants LLC, based on our scope of work. The field locations for the borings and test pits were located by Community Planning & Engineering's (CPE) Surveyor as shown on the plans. The physical locations and elevations of the borings should be considered accurate only to the degree implied by the methods used.

The stratification lines shown on graphic representations of the borings depict the approximate boundaries between soil/rock types and, as such, may denote a gradual transition.

This report has been prepared for the exclusive use of Community Planning and Engineering, Inc., their client, and their consultants for specific application to the proposed East Kapolei Development II, Study Area I, in accordance with generally accepted geotechnical engineering principles and practices. No warranty is expressed or implied.



This report has been prepared solely for the purpose of assisting the architect/engineer in the design evaluation of the proposed project. Therefore, it may not contain sufficient data, or proper information to serve as the basis for preparation of construction cost estimates. A contractor wishing to bid on this project is urged to retain a competent geotechnical engineer to assist in the interpretation of this report and/or in the performance of additional site-specific exploration for bid estimating purposes.

The owner/client should be aware that unanticipated soil/rock conditions are commonly encountered. Unforeseen soil/rock conditions, such as perched ground water, soft deposits, hard layers, or cavities, may occur in localized areas and may require probing or corrections in the field (which may result in construction delays) to attain a properly constructed project. Therefore, a sufficient contingency fund is recommended to accommodate these extra costs.

The findings in this report are valid as of the present date. However, changes in the soil conditions can occur with the passage of time, whether they may be due to natural processes, or to the works of man, on this or adjacent properties. In addition, changes in applicable or appropriate standards occur, whether they result from legislation, or from the broadening of knowledge. Accordingly, the findings in this report might be invalidated, wholly or partially, by changes outside of our control. Therefore, this report is subject to review by the controlling agencies and is valid for a period of 2 years.

LICENSED

PROFESSIONAL

ENGINEER No 3974-

Respectfully submitted,

PSC CONSULTANTS, LLC

Melchor Nolasco

Project Engineer

This work was prepared by me or under my supervision (License Expires April 30, 2010) George Takamiya, P.E. Senior Engineer

George Jakary

MN/GT:lk

Enc.: Plate No. Plate No. 2 Plate No. 3 Plate No. 4 through 25 Plate Nos. 26 through 30

> Plate No. 31A Plate No. 31B Plate No. 32

Plate Nos. 33 through 37 Plate Nos. 39 through 43 Project Location Map

Site Plan

Soils Classification Map


Logs of Borings Logs of Test Pits

Soils Classification Chart Rock Classification Chart

Atterberg Limits Compaction Curve

California Bearing Ratio



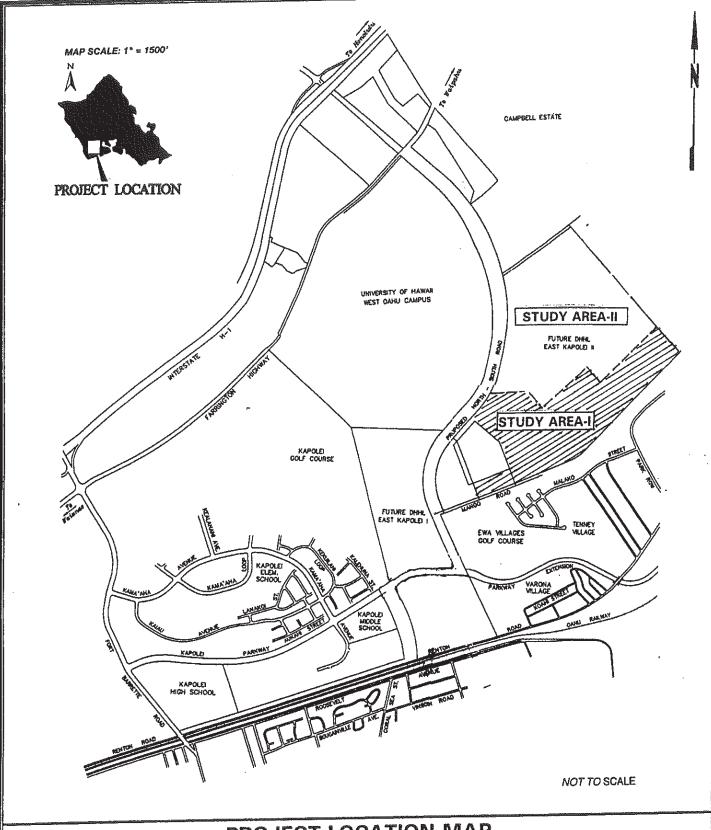

PROJECT LOCATION MAP





CONSULTANTS, LLC SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei II Development Study Area I, Honouliuli, Ewa, Oahu, Hawaii

DATE: May 2007

PROJ. NO.27303.10

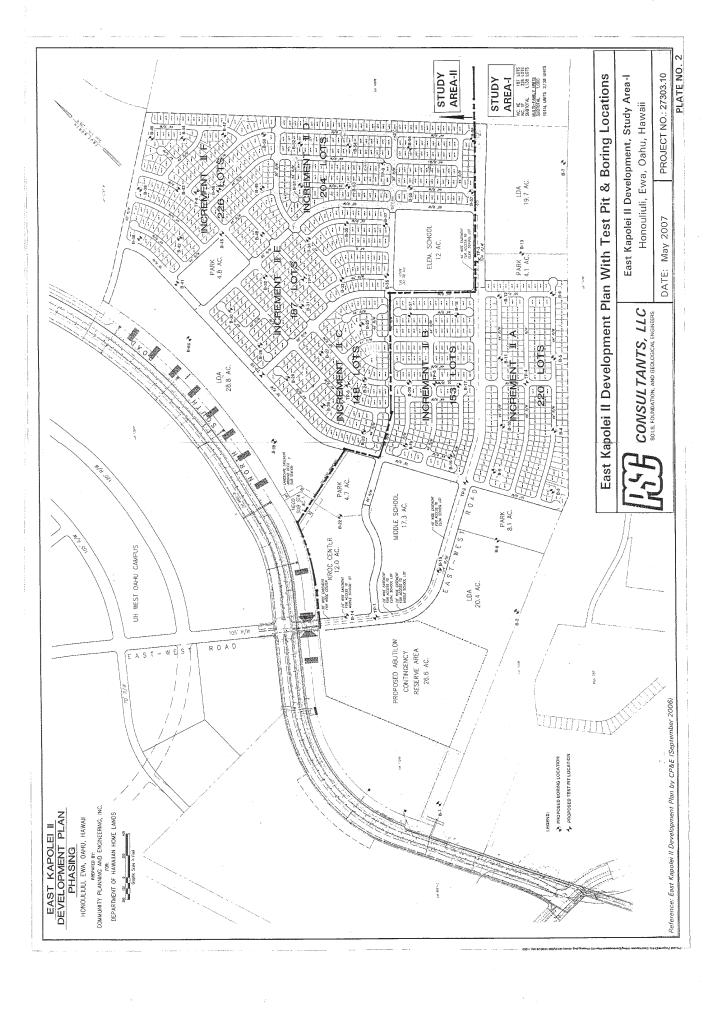

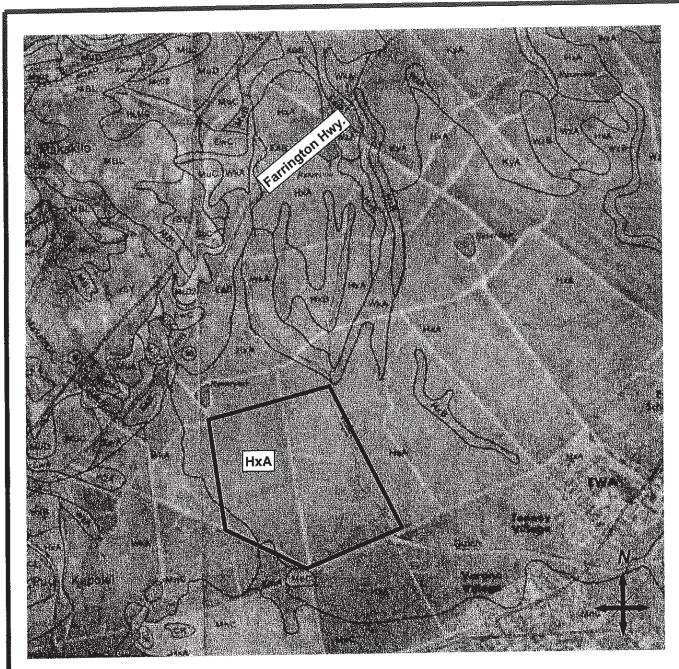



APPROXIMATE SITE LOCATION

HxA

Honouliuli Clay, 0 to 2 percent slopes

REFERENCE: Soil Survey of Kauai, Oahu, Maui, Molokai, and Lanai

NOT TO SCALE

State of Hawaii, United States Department of Agriculture 1972

ISB.

SOILS CLASSIFICATION MAP

East Kapolei II Soil Study Farrington Highway & Farm Road Honouliuli, Ewa, Oahu, Hawaii

DATE: N

MAY 2007

PROJECT NO.

27303.10

PLATE NO.

3

BORING LOCATION: See Site Plan DRILLER: PSC **BORING NO. B-1** LOGGED BY: MGN **BORING ELEVATION: 64.4** DATE (S) DRILLED: 3/11/07 TYPE RIG: Diedrich (D-25) DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) CORE RECOVERY (%) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL U.S.C.S. R.Q.D. (%) **GEOTECHNICAL DESCRIPTION** AUG-1 Coralline GRAVEL, with sand, light brown, poorly graded, GP dense, slightly moist. (Macadam fill) Silty CLAY, brown, hard, moist. 2 3 SPT-1 50 19.0 . 5 AUG-2 6 CL 8 SPT-2 45 22.9 9 -10 AUG-3 12 13 SPT-3 40/2" Coral Formation, very dense. ₩ Boring terminated at 15 feet below ground surface Groundwater not encountered 16 SAMPLE TYPE OTHER LABORATORY TESTS MC - Modified California SPT - Standard Penetration MD - Moisture/Density UC - Unconfined Compression SH - Shelby Tube CON - Consolidation Test CB - Core Barrel SG - Specific Gravity AUG - Auger Cuttings D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection

DATE: May 2007

DRILLER: PSC BORING LOCATION: See Site Plan **BORING NO. B-2** LOGGED BY: MGN **BORING ELEVATION: 62.7** TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/11/07 CORE RECOVERY (%) DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) OTHER LAB TESTS NUMBER OF BLOWS/12" SAMPLE NUMBER DEPTH IN FEET GRAPHIC SYMBOL **GEOTECHNICAL** U.S.C.S. R.Q.D. (%) **DESCRIPTION** ASPHALT GΡ Coralline GRAVEL, with sand, light tan, poorly graded, dense to very dense, moist. (Macadam surface fill) Silty CLAY, brown, very stiff, low to medium plasticity, moist. 2 3 SPT-1 22 20.0 5 AUG-2 6 ÇL 7 8 SPT-2 25 23.8 9 -10 AUG-3 11 12 Silty CLAY, brown, hard, moist. 13 CL SPT-3 22.2 35 14 15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 OTHER LABORATORY TESTS SAMPLE TYPE JORING 2730310.GPJ BORING.GDT 5/18/07 MC - Modified California SPT - Standard Penetration MD - Moisture/Density **UC - Unconfined Compression** SH - Shelby Tube CON - Consolidation Test SG - Specific Gravity CB - Core Barrel SA - Sieve Analysis D&M - Dames & Moore PI - Atterberg Limits AUG - Auger Cuttings OG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection PROJECT NO.: 27303.10 DATE: May 2007

DRILLER: PSC BORING LOCATION: See Site Plan **BORING NO. B-3** LOGGED BY: MGN **BORING ELEVATION: 58.0** TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/11/07 8 MOISTURE CONTENT (%) DRY UNIT WEIGHT (pcf) NUMBER OF BLOWS/12" OTHER LAB TESTS GRAPHIC SYMBOL DEPTH IN FEET SAMPLE NUMBER CORE RECOVERY (USCS **GEOTECHNICAL** R.Q.D. (%) DESCRIPTION **ASPHALT** AUG-' Coralline GRAVEL, with sand, light tan, poorly graded, GP dense, slightly moist. (macadam fill) Silty CLAY, brown, very stiff, low to medium plasticity, CL 2 55.0 3 Silty CLAY, brown, very hard, moist. SPT-1 55 18.5 4 CL - 5 AUG-2 6 7 Silty CLAY, brown, hard, moist. 8 CL SPT-2 38 19.2 9 -10 AUG-3 Silty CLAY, brown, very hard, moist. 11 CL 12 13 SPT-3 50/6" 19.7 14 CORAL, very dense. Boring terminated at 15 feet below ground surface Groundwater not encountered 16 OTHER LABORATORY TESTS SAMPLE TYPE MD - Moisture/Density **UC - Unconfined Compression** 5/18/07 MC - Modified California SPT - Standard Penetration SG - Specific Gravity SH - Shelby Tube CON - Consolidation Test CB - Core Barrel SA - Sieve Analysis PI - Atterberg Limits AUG - Auger Cuttings D&M - Dames & Moore LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, PROJECT NO.: 27303.10 Testing & Inspection DATE: May 2007

DRILLER: PSC BORING LOCATION: See Site Plan **BORING NO. B-4** LOGGED BY: MGN **BORING ELEVATION: 58.9** TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/18/07 CORE RECOVERY (%) MOISTURE CONTENT (%) DRY UNIT WEIGHT (pcf) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET GRAPHIC SYMBOL SAMPLE NUMBER U.S.C.S. **GEOTECHNICAL** R.Q.D. (%) **DESCRIPTION** AUG-ASPHALT Coralline GRAVEL, with sand, poorly graded, dense, GP slightly moist. (Macadam fill) Silty CLAY, brown, hard, low plasticity, moist. 2 3 SPT-1 45 17.4 4 - 5 AUG-2 6 7 CL 8 SPT-2 47 18.0 9 -10 AUG-3 11 12 13 SPT-3 37 21.8 15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 OTHER LABORATORY TESTS SAMPLE TYPE MD - Moisture/Density UC - Unconfined Compression MC - Modified California SPT - Standard Penetration SG - Specific Gravity SH - Shelby Tube CON - Consolidation Test CB - Core Barrel SA - Sieve Analysis PI - Atterberg Limits D&M - Dames & Moore **AUG - Auger Cuttings** LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area II Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, PROJECT NO.: 27303.10

Testing & Inspection

DATE: May 2007

DRILLER: PSC BORING LOCATION: See Site Plan **BORING NO. B-5** LOGGED BY: MGN **BORING ELEVATION: 59.7** TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/18/07 DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL CORE RECOVERY (U.S.C.S. **GEOTECHNICAL** R.Q.D. (%) DESCRIPTION Top Soil, brown, silty clay with organic material, loose, dry. AUG-1 Silty CLAY, brown, hard, moist. 2 3 SPT-1 40 23.0 AUG-2 6 CL 8 SPT-2 46 22.7 9 -10 AUG-3 11 12 13 SPT-3 25.6 45 14 15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 OTHER LABORATORY TESTS SAMPLE TYPE MD - Moisture/Density UC - Unconfined Compression MC - Modified California SPT - Standard Penetration CON - Consolidation Test SG - Specific Gravity SH - Shelby Tube CB - Core Barrel PI - Atterberg Limits SA - Sieve Analysis D&M - Dames & Moore AUG - Auger Cuttings LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection PROJECT NO.: 27303.10 DATE: May 2007

DRILLER: PSC BORING LOCATION: See Site Plan **BORING NO. B-6** LOGGED BY: MGN **BORING ELEVATION: 65.0** TYPE RIG: Diedrich (D-25) **DATE (S) DRILLED: 3/18/07** CORE RECOVERY (%) DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET GRAPHIC SYMBOL SAMPLE NUMBER **GEOTECHNICAL** တ် R.Q.D. (%) S.C. **DESCRIPTION** Top Soil, brown, silty clay with organic material, loose, dry. AUG-1 Silty CLAY, brown, very stiff, low plasticity, moist. 2 CL 3 SPT-1 21 22.4 5 Silty CLAY, brown, hard, moist. AUG-2 6 CL 8 SPT-2 32 20.5 9 10 Silty CLAY, brown, very hard, moist. AUG-3 11 12 CL 13 SPT-3 62 10.7 14 15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 OTHER LABORATORY TESTS SAMPLE TYPE UC - Unconfined Compression 5/21/07 MC - Modified California SPT - Standard Penetration MD - Moisture/Density SG - Specific Gravity CON - Consolidation Test SH - Shelby Tube CB - Core Barrel BORING.GDT SA - Sieve Analysis PI - Atterberg Limits D&M - Dames & Moore AUG - Auger Cuttings OG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area II Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection PROJECT NO.: 27303.10 DATE: May 2007

DRILLER: PSC BORING LOCATION: See Site Plan **BORING NO. B-7** LOGGED BY: MGN **BORING ELEVATION: 63.8** TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/18/07 CORE RECOVERY (%) MOISTURE CONTENT (%) DRY UNIT WEIGHT (pcf) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL U.S.C.S. **GEOTECHNICAL** R.O.D. (%) **DESCRIPTION** ASPHALT AUG-Coralline GRAVEL, with sand, light tan, poorly graded, GP dense, slightly moist. (Macadam fill) Silty CLAY, brown, very stiff, low to medium plasticity, 2 3 SPT-1 19 22.1 CL -5 AUG-2 6 7 Silty CLAY, brown, hard, moist. 8 SPT-2 38 24.2 9 AUG-3 CL 11 12 13 SPT-3 30.4 40 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 OTHER LABORATORY TESTS SAMPLE TYPE UC - Unconfined Compression MD - Moisture/Density MC - Modified California SPT - Standard Penetration CON - Consolidation Test SG - Specific Gravity SH - Shelby Tube CB - Core Barrel BORING GDT PI - Atterberg Limits SA - Sieve Analysis D&M - Dames & Moore AUG - Auger Cuttings LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management,

DATE: May 2007

Testing & Inspection

BORING LOCATION: See Site Plan DRILLER: PSC **BORING NO. B-8** LOGGED BY: MGN **BORING ELEVATION: 60.8** TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/24/07 CORE RECOVERY (%) DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) OTHER LAB TESTS NUMBER OF BLOWS/12" SAMPLE NUMBER DEPTH IN FEET GRAPHIC SYMBOL U.S.C.S. **GEOTECHNICAL** R.Q.D. (%) **DESCRIPTION** AUG-Top Soil, brown, clayey silt with organic material, loose, Silty CLAY, brown, hard, moist. 2 3 SPT-1 17.4 53 4 ٠5 AUG-2 6 CL 8 SPT-2 36 18.4 9 AUG-3 -10 11 12 Silty CLAY, brown, very hard, moist. 13 SPT-3 55 19.8 CL 14 15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 SAMPLE TYPE OTHER LABORATORY TESTS 5/18/07 MD - Moisture/Density UC - Unconfined Compression MC - Modified California SPT - Standard Penetration CON - Consolidation Test SG - Specific Gravity CB - Core Barrel SH - Shelby Tube D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis AUG - Auger Cuttings **BORING** LOG OF East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection PROJECT NO.: 27303.10 DATE: May 2007

BORING LOCATION: See Site Plan DRILLER: PSC **BORING NO. B-9** LOGGED BY: MGN **BORING ELEVATION: 64.2** TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/27/07 CORE RECOVERY (%) DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL **GEOTECHNICAL** U.S.C.S. R.Q.D. (%) DESCRIPTION AUG-Top Soil, brown, clayey silt with organic material, loose, Silty CLAY, brown, stiff, low to medium plasticity, moist. 2 3 CL SPT-1 11 4 5 AUG-2 Silty CLAY, brown, very stiff, low plasticity, moist. 24.1 6 7 8 SPT-2 21 9 -10 AUG-3 24.3 12 13 SPT-3 22 14 15 27.8 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 OTHER LABORATORY TESTS SAMPLE TYPE MD - Moisture/Density UC - Unconfined Compression MC - Modified California SPT - Standard Penetration CB - Core Barrel SH - Shelby Tube CON - Consolidation Test SG - Specific Gravity PI - Atterberg Limits SA - Sieve Analysis D&M - Dames & Moore AUG - Auger Cuttings OG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection PROJECT NO.: 27303.10 DATE: May 2007

BORING 2730310.GPJ BORING.GDT 5/18/07

BORING LOCATION: See Site Plan DRILLER: PSC **BORING NO. B-10** LOGGED BY: MGN **BORING ELEVATION: 64.4** TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/27/07 MOISTURE CONTENT (%) CORE RECOVERY (%) DRY UNIT WEIGHT (pcf) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL U.S.C.S. **GEOTECHNICAL** R.O.D. (%) DESCRIPTION AUG-1 Top Soil, brown, clayey silt with organic material, loose, Sifty CLAY, brown, very stiff, low to medium plasticity, moist. 2 6.2 3 SPT-1 17 CL AUG-2 22.0 6 8 Silty CLAY, brown, hard, moist. SPT-2 41 9 CL AUG-3 22.2 Silty CLAY, brown, very stiff, low to medium plasticity, moist. 12 CL 13 SPT-3 20 29.7 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 SAMPLE TYPE OTHER LABORATORY TESTS MC - Modified California SPT - Standard Penetration MD - Moisture/Density UC - Unconfined Compression CON - Consolidation Test SG - Specific Gravity SH - Shelby Tube CB - Core Barrel AUG - Auger Cuttings D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection

DATE: May 2007

BORING.GDT 5/18/07

2730310.GPJ

BORING LOCATION: See Site Plan DRILLER: PSC **BORING NO. B-11** LOGGED BY: MGN **BORING ELEVATION: 67.6** DATE (S) DRILLED: 3/25/07 TYPE RIG: Diedrich (D-25) CORE RECOVERY (%) MOISTURE CONTENT (%) DRY UNIT WEIGHT (pcf) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL U.S.C.S. R.Q.D. (%) **GEOTECHNICAL DESCRIPTION** AUG-1 Top Soil, brown, clayey silt with organic material, loose, 66.6 Silty CLAY, brown, very stiff, low to medium plasticity, 2 3 SPT-1 16 22.7 4 5 AUG-2 6 CL SPT-2 27.9 23 9 AUG-3 12 13 SPT-3 27 24,2 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 SAMPLE TYPE OTHER LABORATORY TESTS MC - Modified California SPT - Standard Penetration MD - Moisture/Density UC - Unconfined Compression CB - Core Barrel SH - Shelby Tube CON - Consolidation Test SG - Specific Gravity AUG - Auger Cuttings D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I

BORING 2730310.GPJ BORING.GDT

Consultants Construction Management, Testing & Inspection

Honouliuli, Ewa, Oahu, Hawaii

DATE: May 2007

BORING LOCATION: See Site Plan DRILLER: PSC **BORING NO. B-12** LOGGED BY: AA **BORING ELEVATION: 68.8** DATE (S) DRILLED: 3/26/07 TYPE RIG: Diedrich (D-25) CORE RECOVERY (%) DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL S.C.S. **GEOTECHNICAL** R.O.D. (%) DESCRIPTION AUG-Top Soil, brown, clayey silt with organic material, little gravel, loose, dry. Silty CLAY, brown, hard, moist. CL 2 14.0 Silty CLAY, brown, very hard, moist. SPT-1 75 4 .5 AUG-2 17.4 6 7 8 SPT-2 67 9 -10 AUG-3 21.9 12 Silty CLAY, brown, hard, moist. CL SPT-3 31 14 22.6 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 SAMPLE TYPE OTHER LABORATORY TESTS MC - Modified California SPT - Standard Penetration MD - Moisture/Density UC - Unconfined Compression SH - Shelby Tube CON - Consolidation Test CB - Core Barrel SG - Specific Gravity BORING.GDT AUG - Auger Cuttings D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection

DATE: May 2007

DRILLER: PSC BORING LOCATION: See Site Plan **BORING NO. B-13** LOGGED BY: AA **BORING ELEVATION: 67.0** TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/26/07 CORE RECOVERY (%) MOISTURE CONTENT (%) DRY UNIT WEIGHT (pcf) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET GRAPHIC SYMBOL SAMPLE NUMBER U.S.C.S. GEOTECHNICAL R.Q.D. (%) **DESCRIPTION** AUG-Top Soil, brown, clayey silt with organic materials, loose, Silty CLAY, brown, very stiff, low to medium plasticity, 2 3 CL SPT-1 24 36.3 - 5 AUG-2 20.0 6 Silty CLAY, brown, hard, moist. 8 SPT-2 37 9 AUG-3 -10 24.0 CL 11 12 13 SPT-3 30/1" 14 CORAL, very dense. 15 22.9 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 OTHER LABORATORY TESTS SAMPLE TYPE 5/18/07 MD - Moisture/Density UC - Unconfined Compression MC - Modified California SPT - Standard Penetration CON - Consolidation Test SG - Specific Gravity SH - Shelby Tube CB - Core Barrel PI - Atterberg Limits SA - Sieve Analysis AUG - Auger Cuttings D&M - Dames & Moore LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection PROJECT NO.: 27303.10 DATE: May 2007

DRILLER: PSC BORING LOCATION: See Site Plan **BORING NO. B-14** LOGGED BY: MGN **BORING ELEVATION: 76.0** TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/24/07 CORE RECOVERY (%) MOISTURE CONTENT (%) DRY UNIT WEIGHT (pcf) OTHER LAB TESTS NUMBER OF BLOWS/12" SAMPLE NUMBER DEPTH IN FEET GRAPHIC SYMBOL J.S.C.S. **GEOTECHNICAL** R.Q.D. (%) DESCRIPTION AUG-Top Soil, brown, clayey silt with organic material, loose, Silty CLAY, brown, very stiff, low to medium plasticity, moist. CL 2 Silty CLAY, brown, very hard, moist. 3 SPT-1 48 17.4 CL. ٠5 AUG-2 6 7 Silty CLAY, brown, very stiff, low plasticity, moist. 8 SPT-2 20 17.7 9 -10 AUG-31 CL 11 12 13 SPT-3 29 23.6 14 15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 OTHER LABORATORY TESTS SAMPLE TYPE 2730310.GPJ BORING.GDT 5/18/07 MC - Modified California SPT - Standard Penetration MD - Moisture/Density **UC - Unconfined Compression** SG - Specific Gravity CON - Consolidation Test CB - Core Barrel SH - Shelby Tube SA - Sieve Analysis AUG - Auger Cuttings D&M - Dames & Moore PI - Atterberg Limits OG OF **BORING** East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, SORING Testing & Inspection PROJECT NO.: 27303.10 DATE: May 2007

DRILLER: PSC BORING LOCATION: See Site Plan **BORING NO. B-15** LOGGED BY: MGN **BORING ELEVATION: 67.2 DATE (S) DRILLED: 3/24/07** TYPE RIG: Diedrich (D-25) CORE RECOVERY (%) MOISTURE CONTENT (%) DRY UNIT WEIGHT (pcf) NUMBER OF BLOWS/12" OTHER LAB TESTS SAMPLE NUMBER DEPTH IN FEET GRAPHIC SYMBOL U.S.C.S. **GEOTECHNICAL** R.Q.D. (%) **DESCRIPTION** AUG-1 Top Soil, brown, clayey silt with organic material, loose, Silty CLAY, brown, hard, moist. 2 3 SPT-1 46 18.2 5 AUG-2 6 CL 7 8 SPT-2 41 20.7 9 -10 AUG-3 11 12 Silty CLAY, brown, very hard, moist. 13 SPT-3 58 CL 24.7 14 15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 OTHER LABORATORY TESTS SAMPLE TYPE 30RING 2730310.GPJ BORING.GDT 5/18/07 MC - Modified California SPT - Standard Penetration MD - Moisture/Density UC - Unconfined Compression CON - Consolidation Test SG - Specific Gravity SH - Shelby Tube CB - Core Barrel SA - Sieve Analysis D&M - Dames & Moore PI - Atterberg Limits AUG - Auger Cuttings OG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection PROJECT NO.: 27303.10 DATE: May 2007

BORING LOCATION: See Site Plan DRILLER: PSC **BORING NO. B-16 BORING ELEVATION: 69.2** LOGGED BY: AA TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/27/07 DRY UNIT WEIGHT (pcf) CORE RECOVERY (%) MOISTURE CONTENT (%) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL **GEOTECHNICAL** U.S.C.S. R.Q.D. (%) **DESCRIPTION** AUG-Top Soil, brown, clayey silt with organic material, loose, 1 Silty CLAY, brown, very stiff, low plasticity, moist. CL 2 Silty CLAY, brown, hard, moist. 3 SPT-1 36 4 19.1 - 5 AUG-2 6 7 8 SPT-2 42 CL 9 23.8 -10 AUG-3 11 12 13 SPT-3 45 17.8 15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 SAMPLE TYPE OTHER LABORATORY TESTS ORING 2730310.GPJ BORING.GDT 5/18/07 MC - Modified California SPT - Standard Penetration MD - Moisture/Density UC - Unconfined Compression CON - Consolidation Test SG - Specific Gravity CB - Core Barrel SH - Shelby Tube D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis AUG - Auger Cuttings BORING LOG OF East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection PROJECT NO.: 27303.10 DATE: May 2007

BORING LOCATION: See Site Plan DRILLER: PSC **BORING NO. B-17 BORING ELEVATION: 71.3** LOGGED BY: MGN TYPE RIG: Diedrich (D-25) **DATE (S) DRILLED: 3/25/07** CORE RECOVERY (%) DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL U.S.C.S. **GEOTECHNICAL** R.Q.D. (%) DESCRIPTION AUG-1 Top Soil, brown, clayey silt with organic material, loose, 1 Silty CLAY, brown, very stiff, low plasticity, moist. 2 3 SPT-1 22 23.4 4 5 AUG-2 6 7 8 CL SPT-2 30 25.1 9 -10 AUG-3 11 12 13 SPT-3 25 24.9 14 -15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 **SAMPLE TYPE** OTHER LABORATORY TESTS 30RING 2730310.GPJ BORING.GDT 5/16/07 UC - Unconfined Compression MC - Modified California SPT - Standard Penetration MD - Moisture/Density CON - Consolidation Test SG - Specific Gravity SH - Shelby Tube CB - Core Barrel D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis AUG - Auger Cuttings LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection PROJECT NO.: 27303.10 DATE: May 2007

BORING LOCATION: See Site Plan DRILLER: PSC **BORING ELEVATION: 72.8** LOGGED BY: MGN **BORING NO. B-18** DATE (S) DRILLED: 3/25/07 TYPE RIG: Diedrich (D-25) CORE RECOVERY (%) DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL S.C.S. R.Q.D. (%) **GEOTECHNICAL** DESCRIPTION AUG-Top Soil, brown, clayey silt with organic material, loose, slightly moist. Silty CLAY, brown, very stiff, low plasticity, moist. 2 3 SPT-1 24.0 20 5 AUG-2 6 8 CL SPT-2 24.9 27 9 -10 AUG-3 12 13 SPT-3 25.0 28 14 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 SAMPLE TYPE OTHER LABORATORY TESTS MC - Modified California SPT - Standard Penetration MD - Moisture/Density UC - Unconfined Compression CB - Core Barrel SH - Shelby Tube CON - Consolidation Test SG - Specific Gravity AUG - Auger Cuttings D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants



30RING 2730310.GPJ BORING.GDT 5/16/07

Construction Management, Testing & Inspection

Honouliuli, Ewa, Oahu, Hawaii

DATE: May 2007

BORING LOCATION: See Site Plan DRILLER: PSC **BORING ELEVATION: 75.1** LOGGED BY: MGN **BORING NO. B-19** DATE (S) DRILLED: 3/25/07 TYPE RIG: Diedrich (D-25) CORE RECOVERY (%) DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL U.S.C.S. R.Q.D. (%) GEOTECHNICAL **DESCRIPTION** AUG-1 Top Soil, brown, clayey silt, dry. Silty CLAY, brown, very stiff, low to medium plasticity, 2 3 SPT-1 23.3 17 - 5 AUG-2 6 CL 28 SPT-2 24.9 9 AUG-3 -10 11 12 SPT-3 23.4 24 14 15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 SAMPLE TYPE OTHER LABORATORY TESTS MC - Modified California SPT - Standard Penetration MD - Moisture/Density UC - Unconfined Compression CB - Core Barrel SH - Shelby Tube CON - Consolidation Test SG - Specific Gravity PI - Atterberg Limits AUG - Auger Cuttings D&M - Dames & Moore SA - Sieve Analysis OG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection

DATE: May 2007

DRILLER: PSC BORING LOCATION: See Site Plan **BORING NO. B-20 BORING ELEVATION: 78.3** LOGGED BY: MGN TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/25/07 CORE RECOVERY (%) DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL S.C.S. **GEOTECHNICAL** R.Q.D. (%) DESCRIPTION AUG-1 Silty CLAY, brown, stiff, slightly moist. 2 3 CL SPT-1 26.6 13 5 AUG-2 6 Silty CLAY, brown, very stiff, low to medium plasticity, moist. 8 SPT-2 24.5 23 9 -AUG-3 1-10 CL 11 12 13 SPT-3 22.0 28 14 15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 OTHER LABORATORY TESTS SAMPLE TYPE MC - Modified California SPT - Standard Penetration MD - Moisture/Density UC - Unconfined Compression CON - Consolidation Test SG - Specific Gravity CB - Core Barrel SH - Shelby Tube D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis AUG - Auger Cuttings OG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection PROJECT NO.: 27303.10 DATE: May 2007

BORING 2730310.GPJ BORING.GDT 5/18/07

BORING LOCATION: See Site Plan DRILLER: PSC **BORING NO. B-21 BORING ELEVATION: 77.6** LOGGED BY: MGN DATE (S) DRILLED: 3/25/07 TYPE RIG: Diedrich (D-25) CORE RECOVERY (%) MOISTURE CONTENT (%) DRY UNIT WEIGHT (pcf) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET GRAPHIC SYMBOL SAMPLE NUMBER U.S.C.S. **GEOTECHNICAL** R.Q.D. (%) DESCRIPTION AUG-1 Top Soil, brown, clayey silt with organic material, loose, Silty CLAY, brown, very stiff, low to medium plasticity, 2 3 CL SPT-1 23.2 19 - 5 AUG-2 Silty CLAY, brown, very hard, moist. 6 7 ÇL 8 SPT-2 34 21.1 9 -10 AUG-3 Silty CLAY, brown, very stiff, low to medium plasticity, 11 12 CL 13 SPT-3 27 26.8 15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 **SAMPLE TYPE** OTHER LABORATORY TESTS MC - Modified California SPT - Standard Penetration MD - Moisture/Density UC - Unconfined Compression CB - Core Barrel SH - Shelby Tube CON - Consolidation Test SG - Specific Gravity AUG - Auger Cuttings D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management, Testing & Inspection

DATE: May 2007

BORING LOCATION: See Site Plan DRILLER: PSC **BORING NO. B-22** LOGGED BY: AA **BORING ELEVATION: 76.3** TYPE RIG: Diedrich (D-25) DATE (S) DRILLED: 3/27/07 CORE RECOVERY (%) MOISTURE CONTENT (%) OTHER LAB TESTS DRY UNIT WEIGHT (pcf) NUMBER OF BLOWS/12" SAMPLE NUMBER DEPTH IN FEET GRAPHIC SYMBOL S.C.S. **GEOTECHNICAL** R.Q.D. (%) DESCRIPTION AUG-1 Top Soil, brown, clayey silt with organic material, loose, Silty CLAY, brown, very stiff, low to medium plasticity, moist. 2 3 SPT-1 30 20.3 5 AUG-2 6 CL 8 SPT-2 17 9 24.5 AUG-3 -10 11 12 Silty CLAY, some coral gravel, brown, very stiff, low to medium plasticity, moist. ÇL SPT-3 20 14 24.9 15 Boring terminated at 15 feet below ground surface Groundwater was not encountered. 16 SAMPLE TYPE OTHER LABORATORY TESTS MC - Modified California SPT - Standard Penetration MD - Moisture/Density UC - Unconfined Compression CON - Consolidation Test SG - Specific Gravity CB - Core Barrel SH - Shelby Tube BORING.GDT D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis AUG - Auger Cuttings LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii Construction Management,

2730310.GPJ

Testing & Inspection

DATE: May 2007

BORING LOCATION: See Site Plan DRILLER: PSC **BORING ELEVATION: 69.0 BORING NO. TP-1** LOGGED BY: AA DATE (S) DRILLED: 4/25/07 TYPE RIG: CORE RECOVERY (%) DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) OTHER LAB TESTS NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL U.S.C.S. R.Q.D. (%) GEOTECHNICAL **DESCRIPTION** Clayey SILT, brown, clayey silt with organic material, loose, dry. ΜН Silty CLAY, brown, stiff, low to medium plasticity, slightly moist. CL 3 Test Pit terminated at approximately 3.5 feet below ground surface Groundwater was not encountered. SAMPLE TYPE OTHER LABORATORY TESTS MC - Modified California SPT - Standard Penetration MD - Moisture/Density UC - Unconfined Compression CB - Core Barrel SH - Shelby Tube CON - Consolidation Test SG - Specific Gravity AUG - Auger Cuttings D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis OG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area I Consultants Honouliuli, Ewa, Oahu, Hawaii

30RING 2730310.GPJ BORING.GDT 5/18/07

Construction Management, Testing & Inspection

DATE: May 2007

BORING LOCATION: See Site Plan DRILLER: PSC **BORING NO. TP-2** LOGGED BY: AA **BORING ELEVATION: 65.0** TYPE RIG: DATE (S) DRILLED: 4/25/07 CORE RECOVERY (%) MOISTURE CONTENT (%) OTHER LAB TESTS DRY UNIT WEIGHT (pcf) NUMBER OF BLOWS/12" DEPTH IN FEET SAMPLE NUMBER GRAPHIC SYMBOL U.S.C.S. **GEOTECHNICAL** R.Q.D. (%) DESCRIPTION Clayey SILT, brown, clayey silt with organic material, loose, dry. МН Silty CLAY, brown, stiff, low to medium plasticity, moist. CL Test Pit terminated at approximately 3.5 below ground Groundwater not encountered. SAMPLE TYPE OTHER LABORATORY TESTS MD - Moisture/Density UC - Unconfined Compression MC - Modified California SPT - Standard Penetration CON - Consolidation Test SG - Specific Gravity CB - Core Barrel SH - Shelby Tube D&M - Dames & Moore PI - Atterberg Limits SA - Sieve Analysis AUG - Auger Cuttings LOG OF BORING East Kapolei Phase II Development Geotechnical & Environmental Study Area i Consultants

Construction Management, Testing & Inspection

Honouliuli, Ewa, Oahu, Hawaii

DATE: May 2007

BORING LOCATION: See Site Plan					DRILLER: PSC		
BORING ELEVATION: 71.8					D BY: AA	BORING NO. TP-3	
DATE (S) DRILLED: 4/17/07			 	PE R			
OTHER LAB TESTS DRY UNIT WEIGHT (pcf) MOISTURE CONTENT (%) CORE RECOVERY (%) R.Q.D. (%)	NUMBER OF BLOWS/12" SAMPLE NUMBER	DEPTH IN FEET	GRAPHIC SYMBOL	U.S.C.S.	DE	OTECHNICAL SCRIPTION	
		2		CL	Silty CLAY, brown, location of the state of		
AUG - Auger Cuttings D&M - I	Standard Per helby Tube Dames & Mo L	oore OG	CO PI -	- Moi N - Co Atteri	surface Groundwater was not e OTHER LABORATOR sture/Density onsolidation Test oerg Limits ORING East Kapolei Phase II	RY TESTS UC - Unconfined Compression SG - Specific Gravity SA - Sieve Analysis Development	
Consultan Construction Man Testing & Insp	nagement,		Study Area I Honouliuli, Ewa, Oahu, Hawaii DATE: May 2007 PROJECT NO.: 27303.10				

	-				Account to the second						
		OCATI			∍ Plan					ER: PSC	_
BOR	ING E	ELEVAT	ΓΙΟΝ: f	63.7				LC	JGGE	ED BY: AA	BORING NO. TP-4
DAT	Έ (S) Γ	DRILLE	A CONTRACTOR OF THE PARTY OF TH					TY	YPE RI	.IG:	
OTHER LAB TESTS	DRY UNIT WEIGHT (pcf)	MOISTURE CONTENT (%)	CORE RECOVERY (%)	R.Q.D. (%)	NUMBER OF BLOWS/12"	SAMPLE NUMBER	DEPTH IN FEET			GEOTECI DESCRI	IPTION
							- 1	0.00 00 00 00 00 00 00 00 00 00 00 00 00		Top Soil, brown, clayey silt with dry.	
							- 2	X		Silty CLAY, brown, stiff, slightly r	moist.
							- 3		CL		
							4			Test Pit terminated at approximat surface Groundwater not encountered	Itely 3.5 feet below ground
				IPLE TYP			4 —			OTHER LABORATORY TESTS	š
		odified C					netrati			•	Unconfined Compression
		ore Barre Auger Cu			- Shelby M - Dam		¹ oore				Specific Gravity Sieve Analysis
	,UU .	uyo, _	June	<u></u>	1-1	to		G OF		ORING	leve Alialysis
Ti	TI		C	Consult				Marko Company		East Kapolei Phase II Develop Study Area I	•
Consultants Construction Management, Testing & Inspection								<u></u>	Honouliuli, Ewa, Oahu, Hav May 2007 PROJE	ECT NO.: 27303.10	

DATE: May 2007

E ^O E	אור :		ION: S	` Cit	- Dlan	CONTRACTOR OF THE PARTY OF THE		1 -			
					3 Plan		<u></u>			ER: PSC ED BY: MGN	PODING NO TRE
BORING ELEVATION: 75.0 DATE (S) DRILLED: 4/16/07							YPE R		BORING NO. TP-5		
		·				1	1	 '	YPE V	(IG:	
OTHER LAB TESTS	DRY UNIT WEIGHT (pcf)	MOISTURE CONTENT (%)	CORE RECOVERY (%)	R.Q.D. (%)	NUMBER OF BLOWS/12"	SAMPLE	DEPTH IN FEET			DES	TECHNICAL SCRIPTION
							- 2		CL	74.0 Sily CLAY, brown, stiff, moist.	y silt with some organic material,
								9/////		71.5 Test Pit terminated at ap surface	pproximately 3.5 feet below ground
										Groundwater was not en	countered.
SAMPLE TYPE					·			OTHER LABORATOR	Y TESTS		
					- Stand		netratio			sisture/Density	UC - Unconfined Compression
		re Barre uger Cu			Shelby 1 - Dame		core			consolidation Test rberg Limits	SG - Specific Gravity
<i>f</i> s.	<u> </u>	Jyon C.	Aungo	<u> </u>	" Dum			Sp		ORING	SA - Sieve Analysis
F	T	Geo	otechni	ical & E	Environ	and the same of th		<i>2</i> ~ N		East Kapolei Phase II C Study Area	



Construction Management, Testing & Inspection

Honouliuli, Ewa, Oahu, Hawaii

DATE: May 2007

SOIL CLASSIFICATION CHART

独 <i>是</i>	AJOR DIVISI	ANC .	SYME	BOLS	TYPICAL
	AJUK DIVISI	OMO	GRAPH	LETTER	DESCRIPTIONS
	GRAVEL AND	CLEAN GRAVELS		GW	WELL-GRADED GRAVELS, GRAVEL - SAND MIXTURES, LITTLE OR NO FINES
	GRAVELLY SOILS	(LITTLE OR NO FINES)		GP	POORLY-GRADED GRAVELS, GRAVEL - SAND MIXTURES, LITTLE OR NO FINES
COARSE GRAINED SOILS	MORE THAN 50% OF COARSE	GRAVELS WITH FINES		GM	SILTY GRAVELS, GRAVEL - SAND - SILT MIXTURES
	FRACTION RETAINED ON NO. 4 SIEVE	(APPRECIABLE AMOUNT OF FINES)	7.55 7 97.659	GC	CLAYEY GRAVELS, GRAVEL - SAND - CLAY MIXTURES
MORE THAN 50%	SAND AND	CLEAN SANDS		sw	WELL-GRADED SANDS, GRAVELLY SANDS, LITTLE OR NO FINES
OF MATERIAL IS LARGER THAN NO. 200 SIEVE SIZE	SANDY SOILS	(LITTLE OR NO FINES)		SP	POORLY-GRADED SANDS, GRAVELLY SAND, LITTLE OR NO FINES
	50% OR MORE THAN 50% OF COARSE	SANDS WITH FINES		SM	SILTY SANDS, SAND - SILT MIXTURES
	FRACTION PASSING ON NO. 4 SIEVE	(APPRECIABLE AMOUNT OF FINES)		sc	CLAYEY SANDS, SAND - CLAY MIXTURES
A THE PROPERTY OF THE PROPERTY				ML	INORGANIC SILTS AND VERY FINE SANDS, ROCK FLOUR, SILTY OR CLAYEY FINE SANDS OR CLAYEY SILTS WITH SLIGHT PLASTICITY
FINE GRAINED SOILS	SILTS AND CLAYS	LIQUIÐ LIMIT LESS THAN 50		CL	INORGANIC CLAYS OF LOW TO MEDIUM PLASTICITY, GRAVELLY CLAYS, SANDY CLAYS, SILTY CLAYS, LEAN CLAYS
SOILS				OL	ORGANIC SILTS AND ORGANIC SILTY CLAYS OF LOW PLASTICITY
50 % OR MORE THAN 50% OF MATERIAL IS SMALLER THAN NO. 200 SIEVE				МН	INORGANIC SILTS, MICACEOUS OR DIATOMACEOUS FINE SAND OR SILTY SOILS
SIZE	SILTS AND CLAYS	LIQUID LIMIT GREATER THAN OR EQUAL TO 50		СН	INORGANIC CLAYS OF HIGH PLASTICITY
				ОН	ORGANIC CLAYS OF MEDIUM TO HIGH PLASTICITY, ORGANIC SILTS
H	OILS	778 778 778 778 8 778 778 778 7 778 778	PT	PEAT, HUMUS, SWAMP SOILS WITH HIGH ORGANIC CONTENTS	

UNIFIED SOIL CLASSIFICATION SYSTEM



CONSULTANTS, LLC SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei Phase II Development Study Area I

Honouliuli, Ewa, Oahu Hawaii

DATE: May 2007

i. CONSOLIDATION OF SEDIMENTARY ROCKS; usually determined from unweathered samples. Largely dependent on cementation.

U = unconsolidated

P = poorly consolidated

M = moderately consolidated

W = well consolidated

II. BEDDING OF SEDIMENTARY ROCKS

Splitting Property

Thickness

Stratification

Massive

Greater than 4.0 ft.

Very Thick-Bedded

Very Thin-Bedded

Blocky

2.0 to 4.0 ft.

Thick-Bedded

Slabby

0.2 to 2.0 ft.

This Dealshad

Flaggy

0.05 to 0.2 ft.

Thin-Bedded

Shaly or Platy

0.03 to 0.2 ft.

. . . .

-

0.01 to 0.00 tt.

Laminated

Papery

Less than 0.01 ft.

Thinly Laminated

III. FRACTURING

Intensity

Size of Pieces in Feet

Very Little Fractured

Greater than 4.0

Occasionally Fractured

1.0 to 4.0

Moderately Fractured

0.5 to 1.0

Closely Fractured

0.1 to 0.5

Intensely Fractured

0.05 to 0.1

Crushed

Less than 0.05

IV. HARDNESS

- Soft reserved for plastic material alone.
- Low Hardness can be gouged deeply r carved easily with a knife blade.
- Moderately Hard can be readily scratched by a knife blade; scratch leaves a heavy trace of dust and is readily visible after the powder has been blown away.
- 4. Hard can be scratched with difficulty; scratch produces little powder and is often faintly visible.
- 5. Very Hard cannot be scratched with a knife blade; leaves a metallic streak.

V. STRENGTH


- 1. Plastic or very low strength.
- 2. Friable crumbles easily by rubbing with fingers.
- 3. Weak an unfractured specimen of such material will crumble under light hammer blows.
- 4. Moderately Strong specimen will withstand a few heavy hammer blows before breading.
- 5. Strong specimen will withstand a few heavy ringing hammer blows and will yield with difficulty only dust and small flying fragments.
- 6. Very Strong specimen will resist heavy ringing hammer blows and will yield with difficulty only dust and small flying fragments.
- VI. WEATHERING The physical and chemical disintegration and decomposition of rocks and minerals by natural processes such as oxidation, reduction, hydration, solution, carbonation and freezing and thawing.
 - Deep moderate to complete mineral decomposition; extensive disintegration; deep and thorough discoloration; many fractures, all
 extensively coated or filled with oxides, carbonates and/or clay or silt.
 - M. Moderate slight change or partial decomposition of minerals; little disintegration; cementation little to unaffected; moderate to occasionally intense discoloration; moderately coated fractures.
 - Little no megascopic decomposition of minerals; little or no affect on normal cementation; slight and intermittent, or localized discoloration; few stains on fracture surfaces.
 - F. Fresh unaffected by weathering agents; no disintegration or discoloration; fractures usually less numerous than joints.


PSC CONSULTANTS, LLC


SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei II Development, Study Area I Honouliuli, Ewa , Oahu, Hawaii

DATE: May 2007

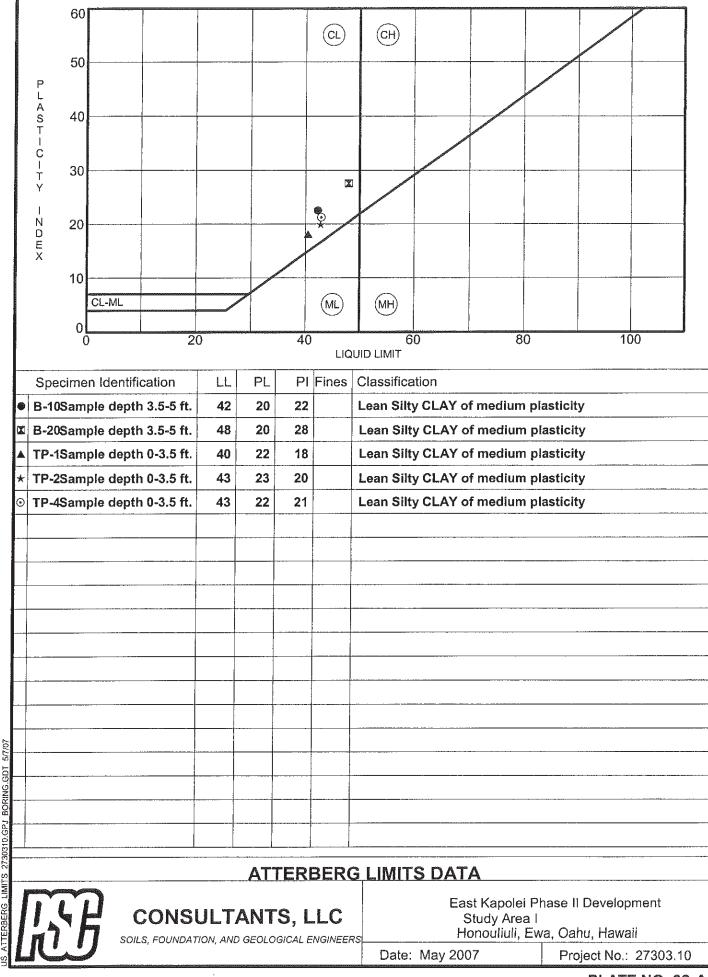

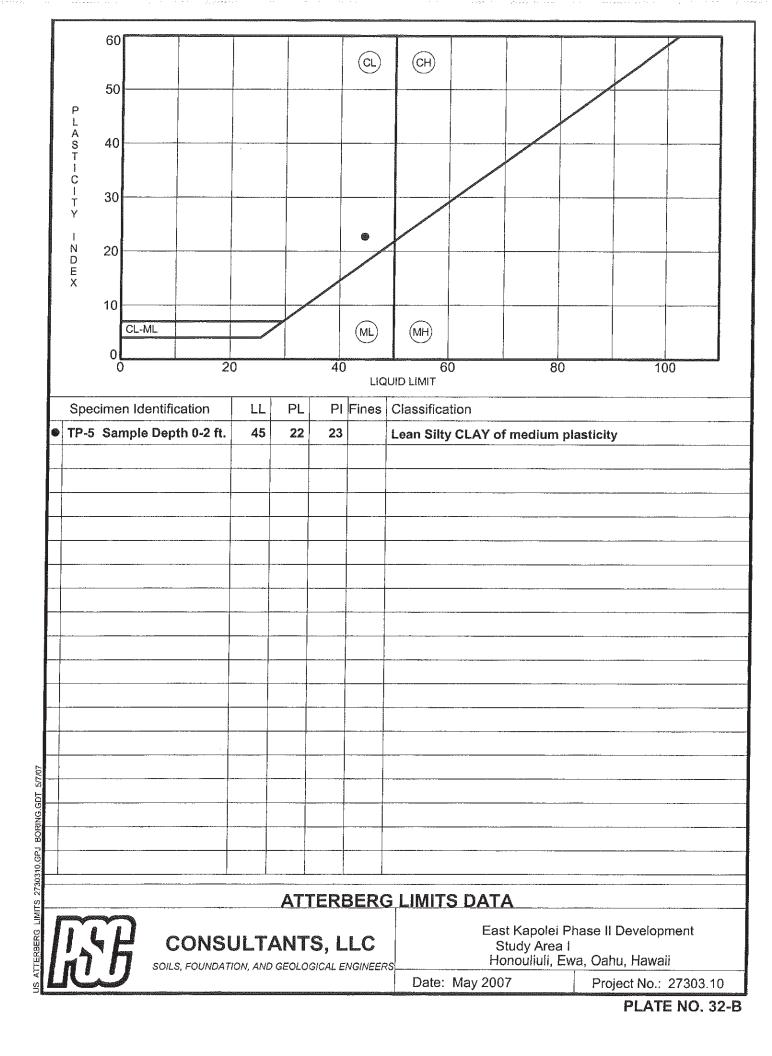

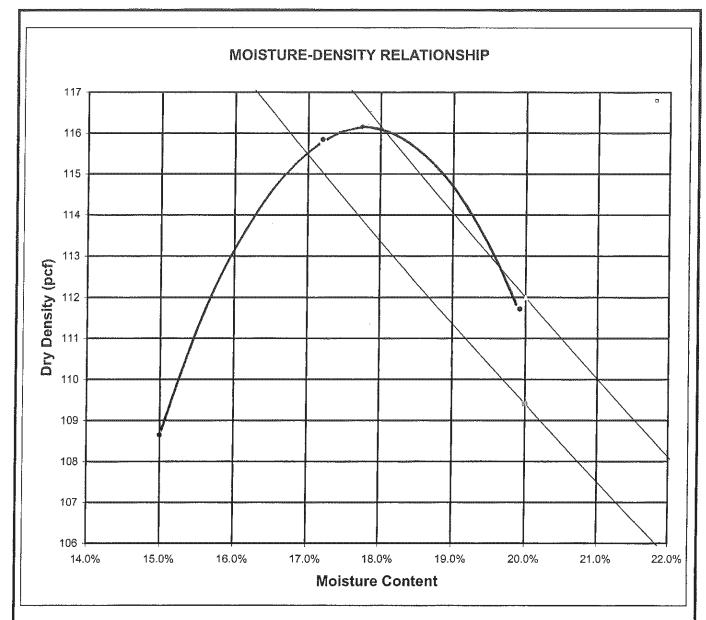

Sample Source: E.Kapolei Phase II TP-1 Description: silty sandy brownish CLAY

	Test Point 1	Test Point 2	Test Point 3	Test Point 4
Wet Density				
(pcf)	124.94	135.77	133.97	
Moisture				
Content	15.00%	17.20%	19.92%	
Dry Density				
(pcf)	108.65	115.85	111.72	

Maximum Dry Density (pcf): Optimum Moisture Content (%): 116.2

17.75%

Test Method: ASTM D-1557

Atterberg Limits

PL.

<u>Pl</u>

COMPACTION TEST RESULTS ASTM D-1557




PSC Consultants, LLC

SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei Phase II Dev. Mon. Moisture Density Relationship East Kapolei Oahu, Hawaii

LL

Date: April 27, 2007

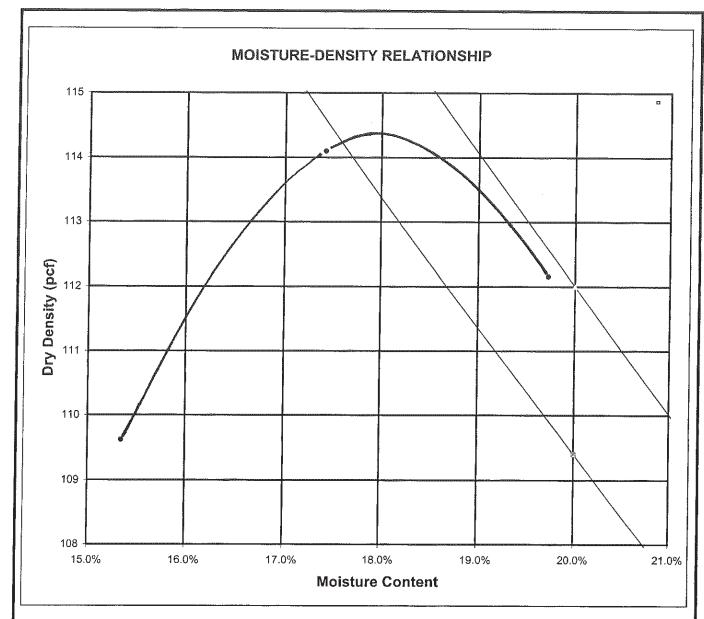

Description: silty sandy brownish CLAY

<u>LL</u>

	Test Point 1	Test Point 2	Test Point 3	Test Point 4
Wet Density (pcf)	126.44	133.97	134.27	
Moisture				
Content	15.35%	17.42%	19.72%	
Dry Density				
(pcf)	109.62	114.10	112.16	

Maximum Dry Density (pcf):

114.5

Optimum Moisture Content (%): 1

17.90%

Test Method: ASTM D-1557

Atterberg Limits

PL

PI

COMPACTION TEST RESULTS

ASTM D-1557




PSC Consultants, LLC

SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei Phase II Dev. Mon. Moisture Density Relationship East Kapolei Oahu, Hawaii

Date: April 30, 2007

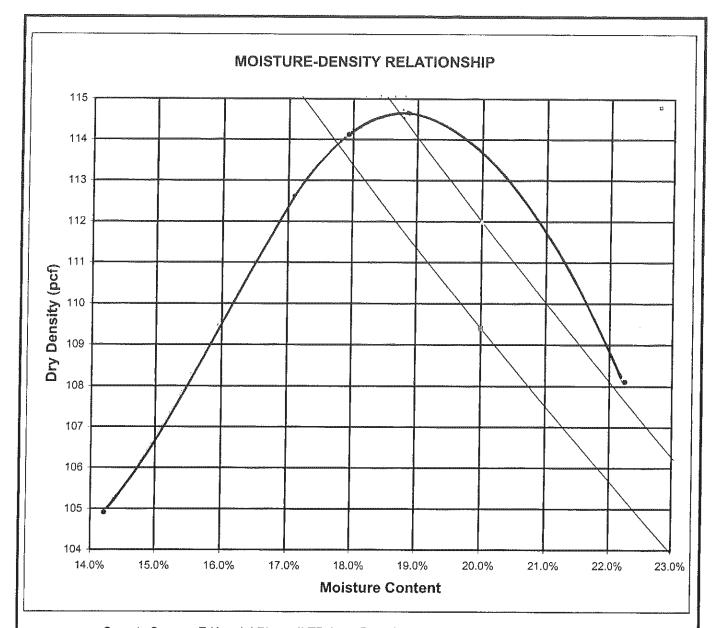

Description: Silty, Sandy, CLAY

		Test Point 1	Test Point 2	Test Point 3	Test Point 4
	Wet Density				
ľ	(pcf)	119.82	134.58	132.16	
	Moisture				
ŀ	Content	14.22%	17.93%	22.25%	
	Dry Density				
	(pcf)	104.91	114.12	108.11	ľ

Maximum Dry Density (pcf):

114.75

Atterberg Limits <u>PL</u>

<u>LL</u>

<u>PI</u>

Optimum Moisture Content (%): 18.8% Test Method: ASTM D-1557

COMPACTION TEST RESULTS ASTM D-1557




PSC Consultants, LLC

SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei Phase II Dev. Mon. Moisture Density Relationship East Kapolei Oahu, Hawaii

Date: April 23, 2007

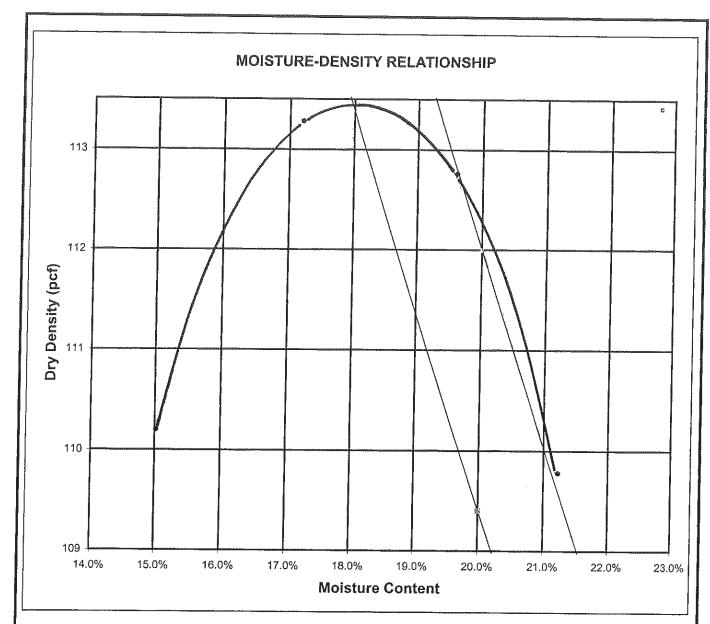

Description: silty sandy brownish CLAY

<u>LL</u>

	Test Point 1	Test Point 2	Test Point 3	Test Point 4
Wet Density				
(pcf)	126.75	132.77	134.87	133.07
Moisture				
Content	15.02%	17.21%	19.61%	21.22%
Dry Density				
(pcf)	110.20	113.28	112.76	109.78

Maximum Dry Density (pcf): Optimum Moisture Content (%): 113.4 17.90%

Test Method: ASTM D-1557

Atterberg Limits

PL

Pl

COMPACTION TEST RESULTS ASTM D-1557



PSC Consultants, LLC


SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei Phase II Dev. Mon.

Moisture Density Relationship

East Kapolei Oahu, Hawaii

Date: April 24, 2007

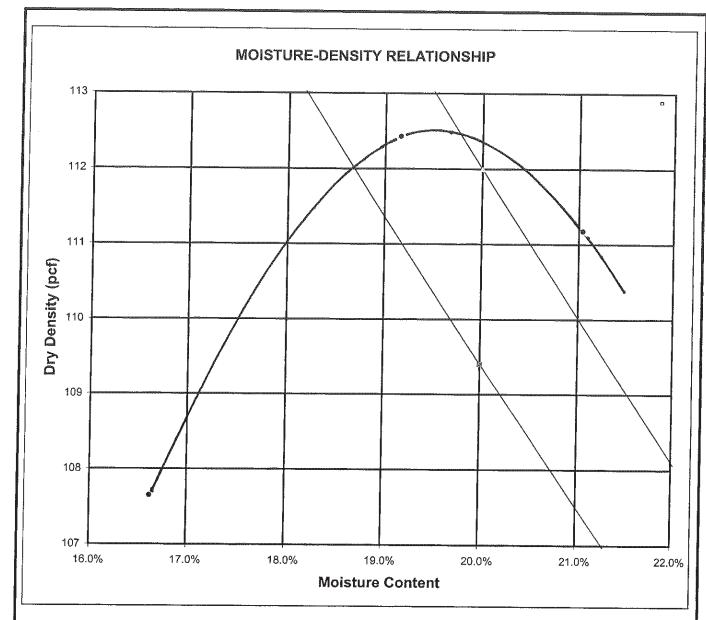

Description: silty sandy brownish CLAY

	Test Point 1	Test Point 2	Test Point 3	Test Point 4
Wet Density				
(pcf)	125.54	133.97	134.57	
Moisture		-		
Content	16.62%	19.16%	21.04%	
Dry Density				71711
(pcf)	107.65	112,43	111.18	

Maximum Dry Density (pcf):

112.5

Optimum Moisture Content (%):

19.60%

Test Method: ASTM D-1557

Atterberg Limits

<u>PL</u>

PI

COMPACTION TEST RESULTS

ASTM D-1557




PSC Consultants, LLC

SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei Phase II Dev. Mon. Moisture Density Relationship East Kapolei Oahu, Hawaii

Date: April 23, 2007

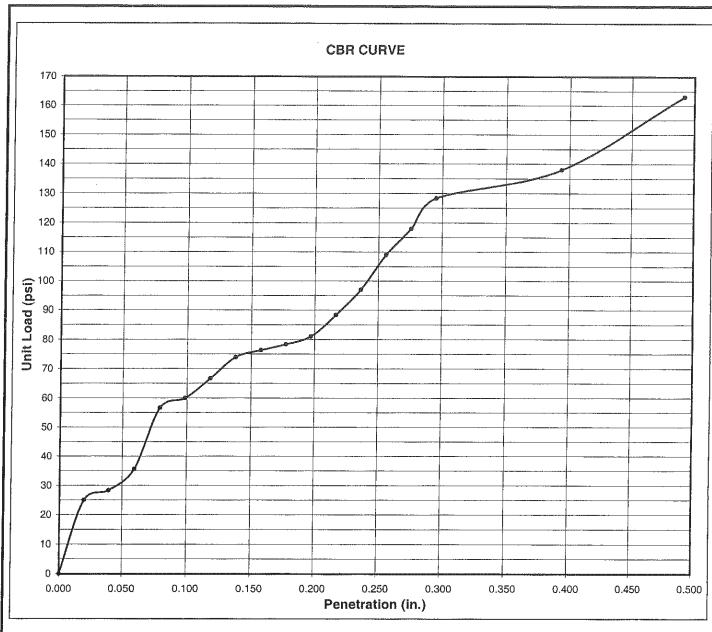

Depth:

0-3.5

Description: Brown Silty CLAY (CH)

Relative Compaction (%):

Moisture Content (%):

Dry Density (pcf):

Percent Swell or Expansion Value (%):

Compaction Test Method: CBR Value @ 0.1" Corrected: CBR Value @ 0.2" Corrected:

Before	After			
Expansion	Expansion			
100.00%	96.74%			
16.63%	19.15%			
116.20	112.42			
3.37	' %			
ASTM D-	·1557 A			
4.82%				
4.45	5%			

Atterberg Limits
LL PL PI

CALIFORNIA BEARING RATIO ASTM D-1883-94




PSC Consultants, LLC

SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei-II Development Study Area I

Honouliuli, Ewa, Oahu, Hawaii

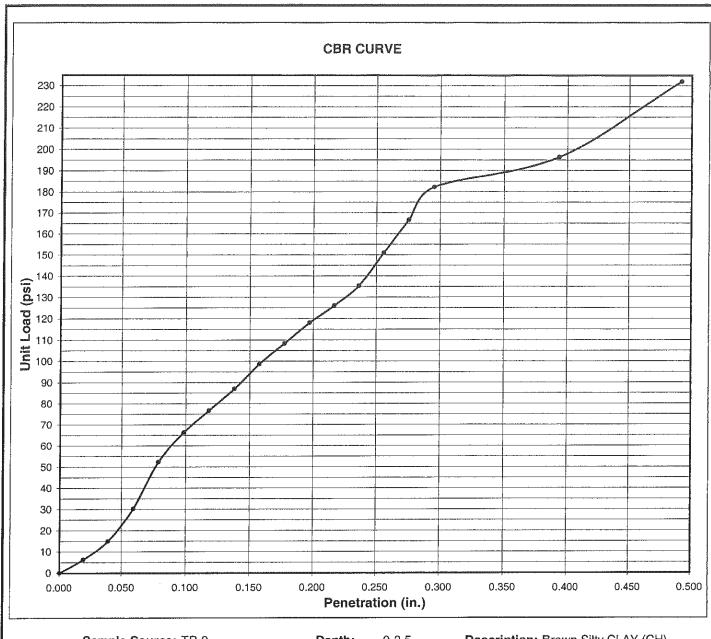

Depth:

0-3.5

Description: Brown Silty CLAY (CH)

Relative Compaction (%): Moisture Content (%): Dry Density (pcf): Percent Swell or Expansion Value (%): Compaction Test Method:

> CBR Value @ 0.1" Corrected: CBR Value @ 0.2" Corrected:

Aπer				
Expansion				
99.45%				
18.00%				
113.47				
%				
ASTM D-1557 A				
6.40%				

6.30%

Atterberg Limits <u>LL</u>

CALIFORNIA BEARING RATIO ASTM D-1883-94




PSC Consultants, LLC SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS East Kapolei-II Development Study Area I

Honouliuli, Ewa, Oahu, Hawaii

Date: May, 2007 PROJECT NO. 27303.10

ΡĮ

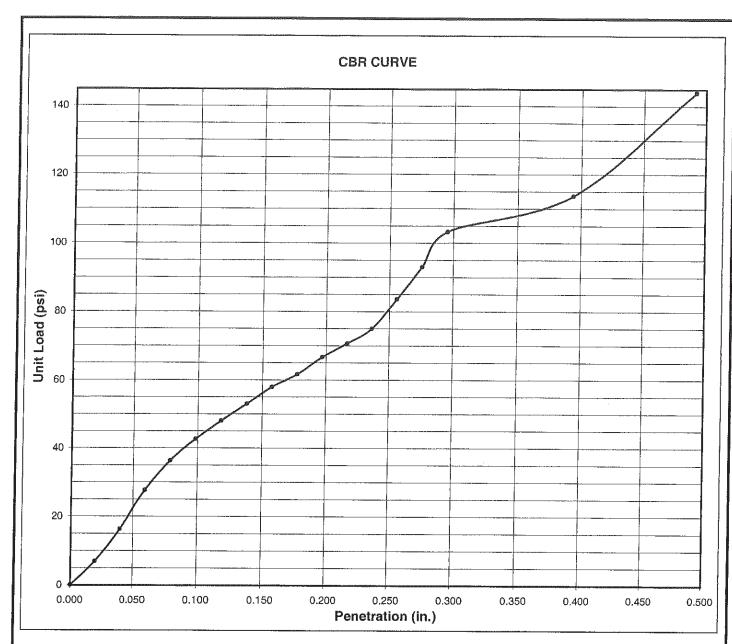

Depth:

0-3.5

Description: Brown Silty CLAY (CH)

	Before	After
	Expansion	Expansion
Relative Compaction (%):	100.00%	96.00%
Moisture Content (%):	118.82%	21.14%
Dry Density (pcf):	114.73	110.78
Percent Swell or Expansion Value (%):	3.57	%
Compaction Test Method:	ASTM D-	1557 A
CBR Value @ 0.1" Corrected:	3.63	%
CBR Value @ 0.2" Corrected:	3.86	%

Atterberg Limits

LL PL PI
51.50 44 7.5

CALIFORNIA BEARING RATIO ASTM D-1883-94



PSC Consultants, LLC

SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei-II Development Study Area I

Honouliuli, Ewa, Oahu, Hawaii



Depth:

0-3.5 ft.

Description: Brown CLAY

Relative Compaction (%):

Moisture Content (%):

Dry Density (pcf):

Percent Swell or Expansion Value (%):

all or Expansion Value (%):
Compaction Test Method:
CBR Value @ 0.1":
CBR Value @ 0.2":

Before	After		
Expansion	Expansion		
97.13%	92.00%		
17.97%	23.64%		
110.04	104.40		
5.40%			
ASTM D-1557 A			
2.5			

Atterberg Limits
LL PL

<u>Pi</u>

CALIFORNIA BEARING RATIO ASTM D-1883-94

2.1




PSC Consultants, LLC

SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei-II Development Study Area I

Honouliuli,Ewa, Oahu, Hawaii

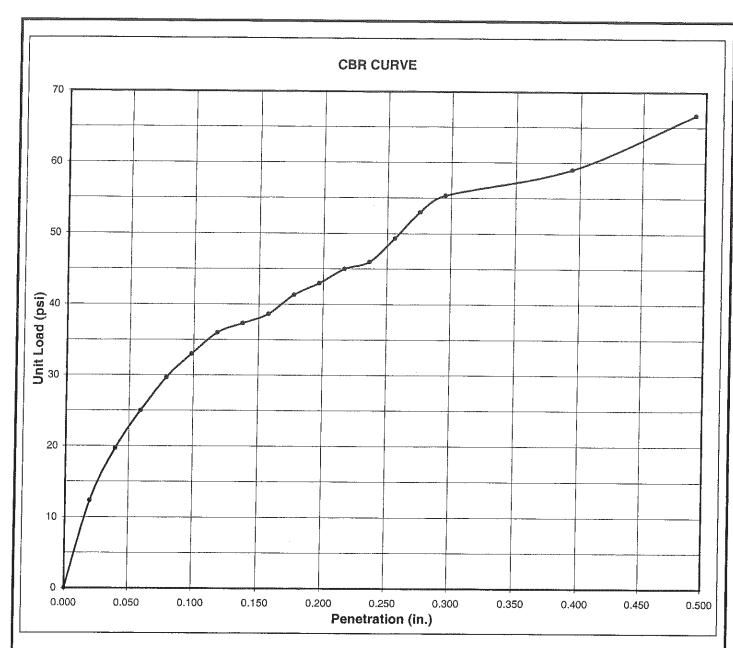

Depth:

0-3.5

After

Description: Brown Silty CLAY (CH)

Relative Compaction (%): 99.21%
Moisture Content (%): 13.98%
Dry Density (pcf): 111.55

Percent Swell or Expansion Value (%): Compaction Test Method: ASTI

CBR Value @ 0.2" Corrected:

 Expansion
 Expansion

 99.21%
 93.82%

 13.98%
 20.54%

 111.55
 105.48

 5.75%
 ASTM D-1557 A

 2.44%
 1.86%

 Atterberg Limits

 LL
 PL
 P

 45.00
 22
 23

CALIFORNIA BEARING RATIO ASTM D-1883-94



PSC Consultants, LLC

SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei-II Development Study Area I

Honouliuli, Ewa, Oahu, Hawaii

One Dimensional Swell Test

Sample	Sample	Molding Moisture	Surcharge	Percent Swell
Source	Depth	(%)	(psf)	(%)
TP-1	0-3.5 ft.	19.23	71.28	3.77
TP-2	0-3.5 ft.	15.84	69.66	8*
TP-3	0-3.5 ft.	22	63.66	2.8
TP-4	0-3.5 ft.	20.28	69.21	3.72
TP-5	0-3.5 ft.	22.51	71.43	4.53

Note 1: The above swell test samples were obtained by pressing 1-inch ring samplers (with a hydraulic press) into the compacted and extruded soil samples from the proctor test specimens at approximately 2% above optimum moisture content (except Sample TP-2*). This procedure aims to simulate field conditions after moisture conditioning and compaction of the insitu soils. The surcharge load simulates a floor slab or pavement dead load. The samples were then soaked for 72 hours or until no further expansion were observed.

Note 2: Sample TP-2 was remolded at approximately 2% below its optimum moisture content and shows a relatively higher swell value of 8%. This demonstrates the relationship of the soils initial moisture content and its sensitivity to swelling resulting from moisture absorption.


One Dimensional Swell Test



East Kapolei II Development, Study Area I Honouliuli, Ewa, Oahu, Hawaii

DATE: May 2007

PROJ. NO.27303.10

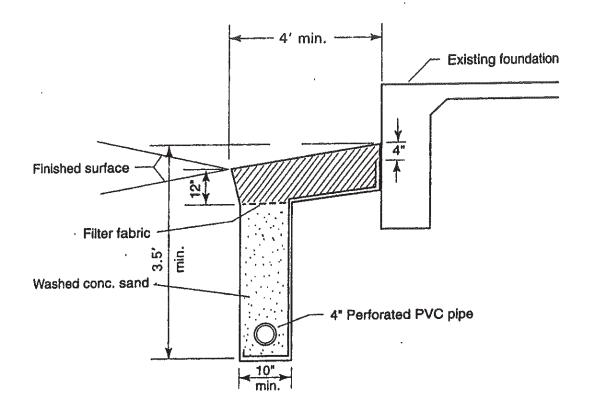

Reference: Kirby Meyers Remediation Design: (GEOMEMBRANES & the Control of Expansive Soils in Construction by M Steinberg, 1998)

Remediation Design-Subdrain with Vertical Moisture Barrier



CONSULTANTS, LLC

SOILS, FOUNDATION, AND GEOLOGICAL ENGINEERS

East Kapolei II Development, Study Area-I Honouliuli, Ewa, Oahu, Hawaii

DATE: May 2007